



Trying to work it back and forth to see if there is any wear or movement in the wheel dampners. These are really tight

Like Comment A Share



Write a comment...






© @ @ @

Friend Requests



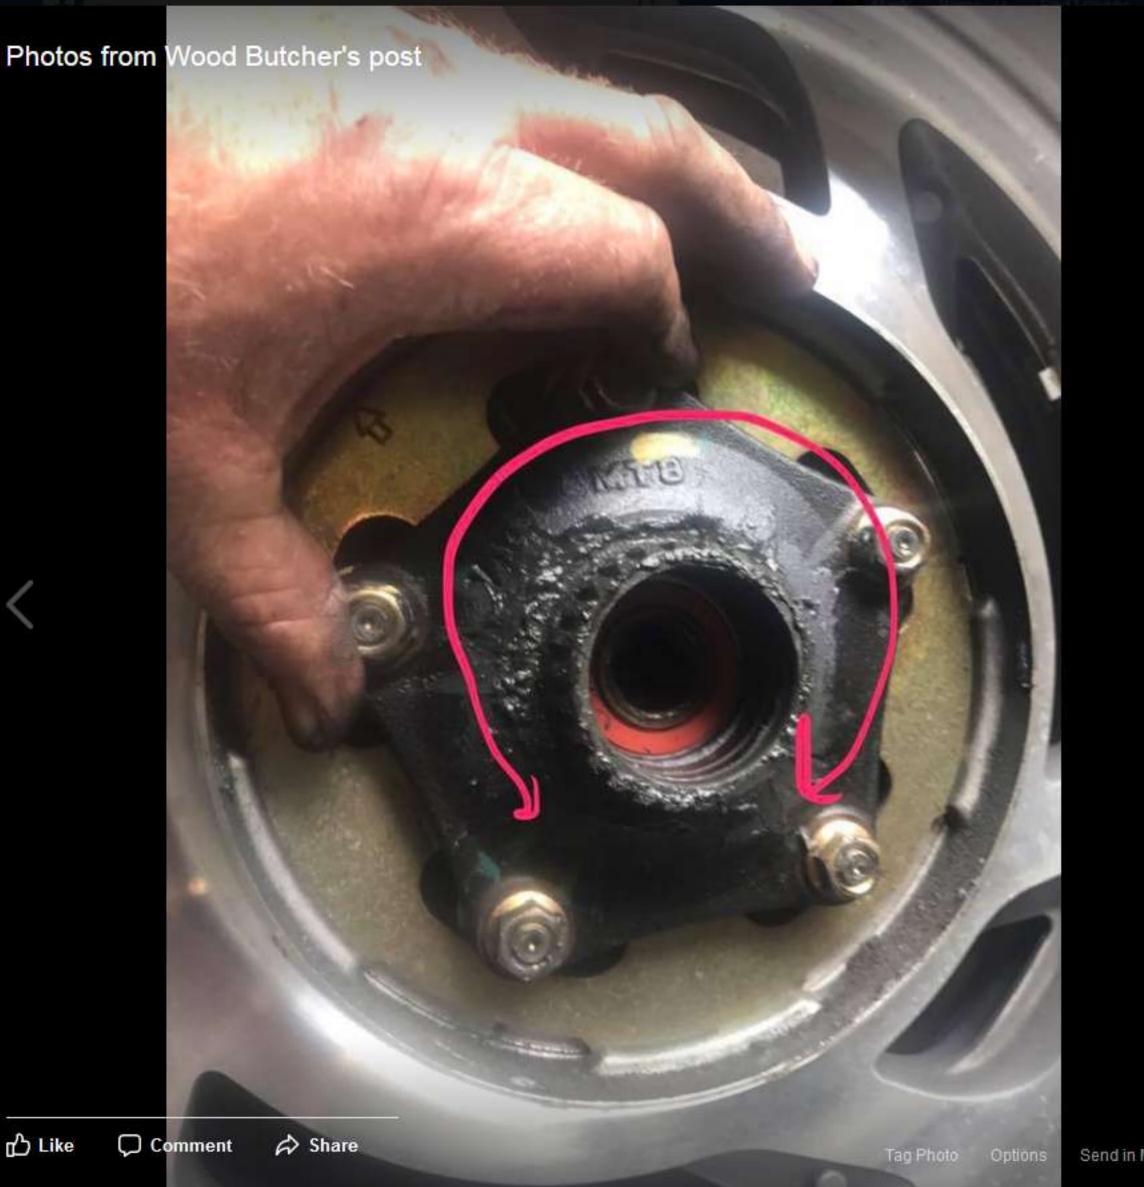



Trying to work it back and forth to see if there is any wear or movement in the wheel dampners. These are really tight

Like
 Comment
 Share

© @ @ ® Write a comment...

Friend Requests

See All





Wood Butcher ▶ Honda Valkyrie

12 hrs - 🚱

Pins where really dry and hard to get the drive flange off. The pins seat into the wheel dampners to cushion the jerk on and off the throttle. The dampners are about \$35 for new ones and very easy to change but these are really good

Like
☐ Comment
☐ Share



Write a comment...









See All







The thrush washer is here and need to be sure it goes back on, if it shows wear replace it. I do mine every other tire change.

Like
 □ Comment
 ⇔ Share

0 1



Write a comment...









Friend Requests









This one looks good enough to make it till next time.

Like Comment A Share

0 1











Friend Requests





Wood Butcher ▶ Honda Valkyrie

12 hrs - 🚱

Check the wheel bearings for smoothness and any movement and clean everything up

Like
 □ Comment
 ⇔ Share





Write a comment...






Friend Requests

See All





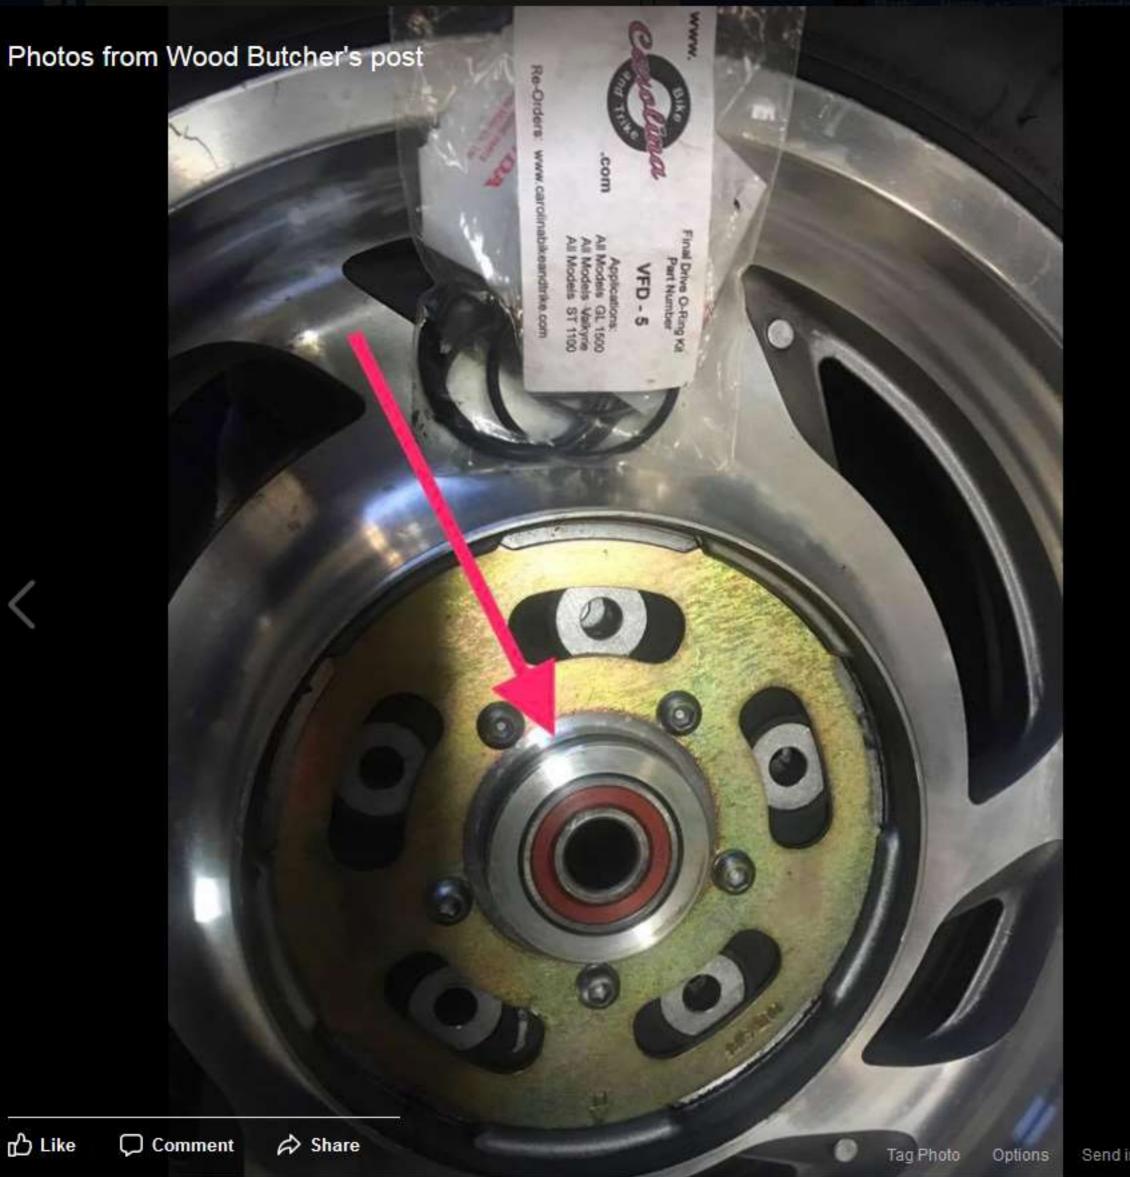



Wood Butcher ▶ Honda Valkyrie

The first of 3 o rings goes here, it is the thinnest of the 3. Remove the old clean the groove real good apply a little grease and put the new one on





Thomas Reichard I just used this picture to order the O rings needed. Thanks for Posting Man!

Like Reply 0 1 10 hrs



Write a comment...







Next

Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend





Pull the spacer out, one end is belled and the other is not. The small end goes in the hole 1st

Like
 Comment
 Share

Write a comment...



© @ @ @



Friend Requests

See All





Clean up the splines real good with some brake cleaner and compressed air.

Like
 □ Comment
 ⇔ Share

Write a comment...

© @ @ 0





Friend Requests


See All



Gracie Zorita Robson 1+ Confirm Friend

Like

Comment

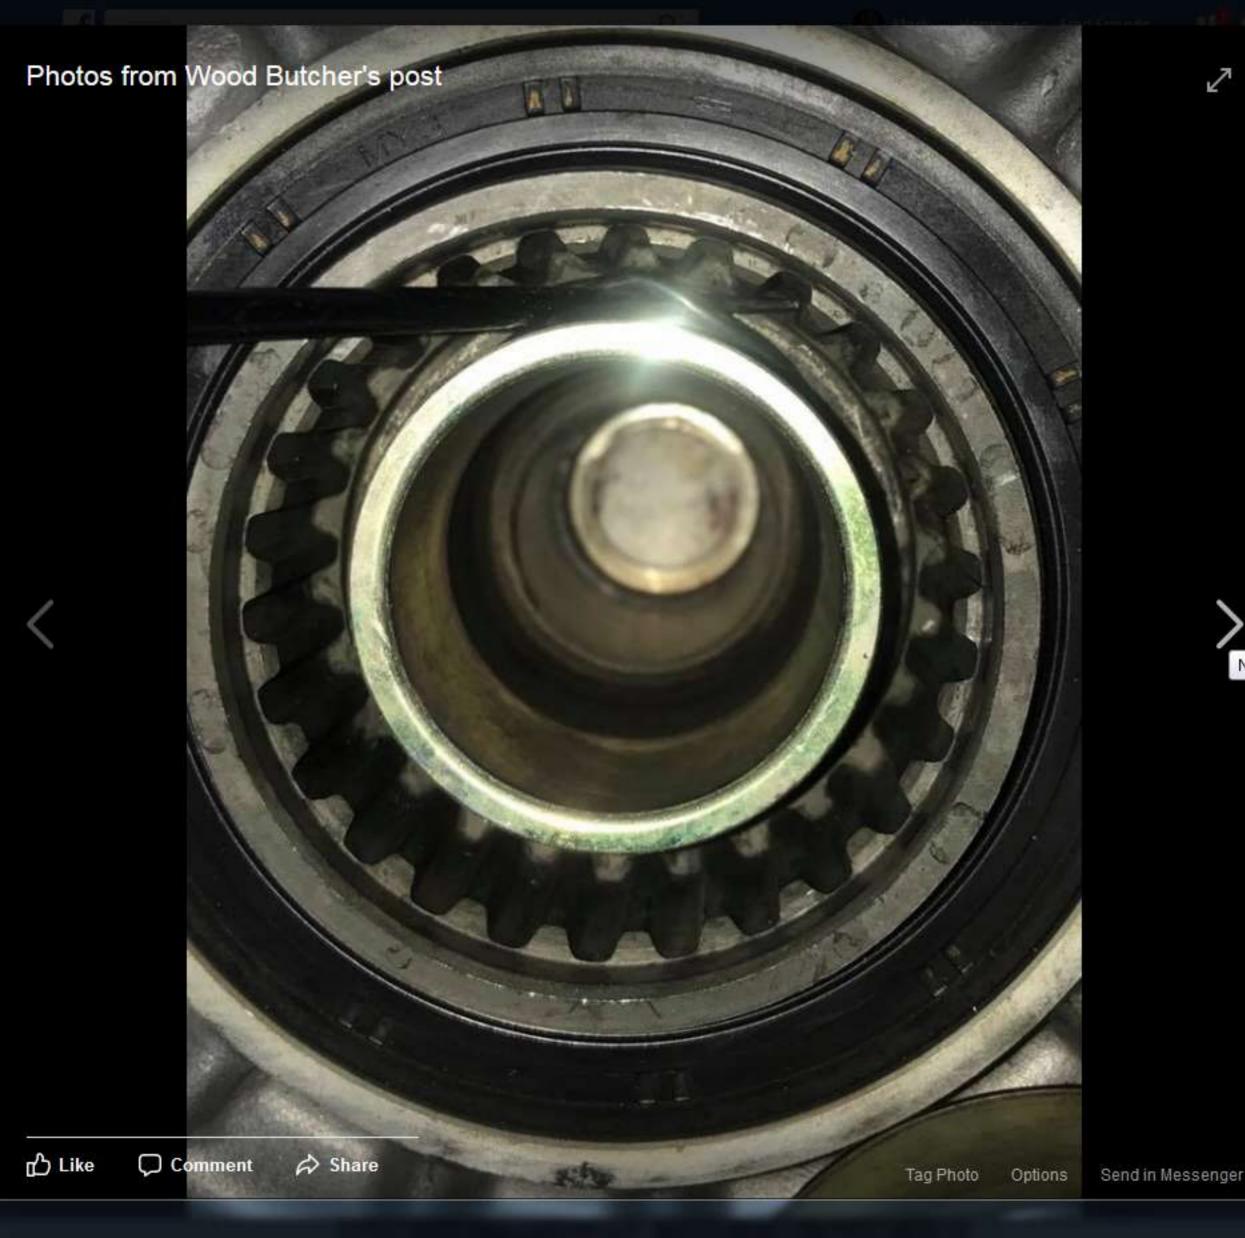



Here's the reason I believe for all the grease leaked out of the drive flange. The o ring is all the way at the bottom of the splines and it should be at the top in the groove. There was nothing in the top groove and after searching found it in the bottom

🖒 Like 🔎 Comment 🖒 Share

Cindy Ewing I knew those bozzos that not only gouged my hard bag didnt do the job I paid them to do.... I cant thank you enough....God really did send you to protect me and the dragon.

Like Reply 2 hrs







Next

Friend Requests

See All






Put a little grease on the new o ring and put it on the shaft in the groove at the top

Like
 □ Comment
 ⇔ Share

Write a comment...



© @ @ @

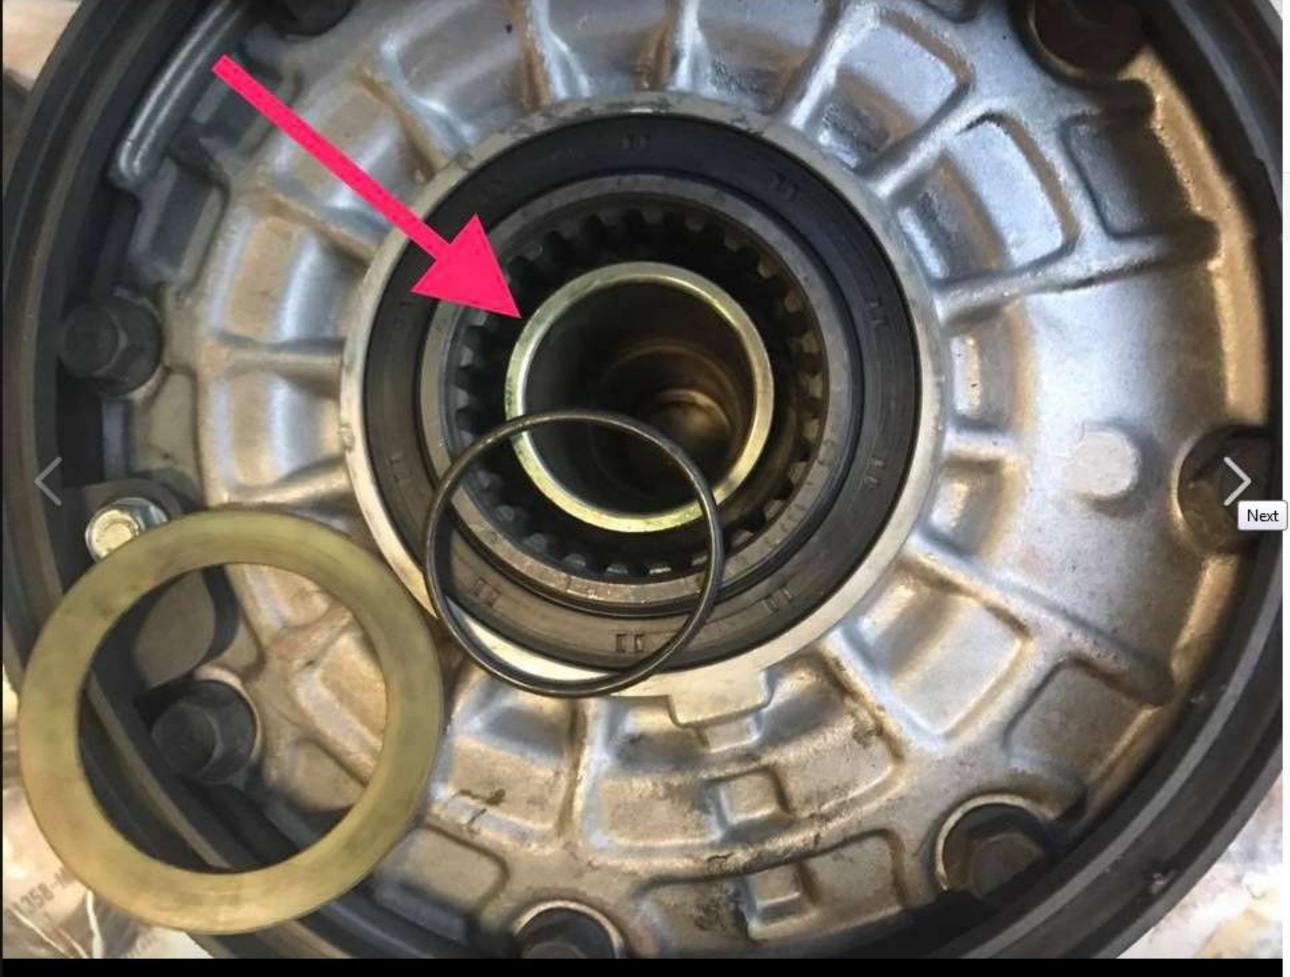

Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend



Wood Butcher ▶ Honda Valkyrie

Clean up the splines on the drive flange real good. These splines look really good but the bike only has 16,000 miles on it.

🖒 Like 💭 Comment 🖒 Share





Write a comment...









Friend Requests

See All




Gracie Zorita Robson 1+ Confirm Friend

r Like Comment Comment

⇔ Share


Tag Photo

Options

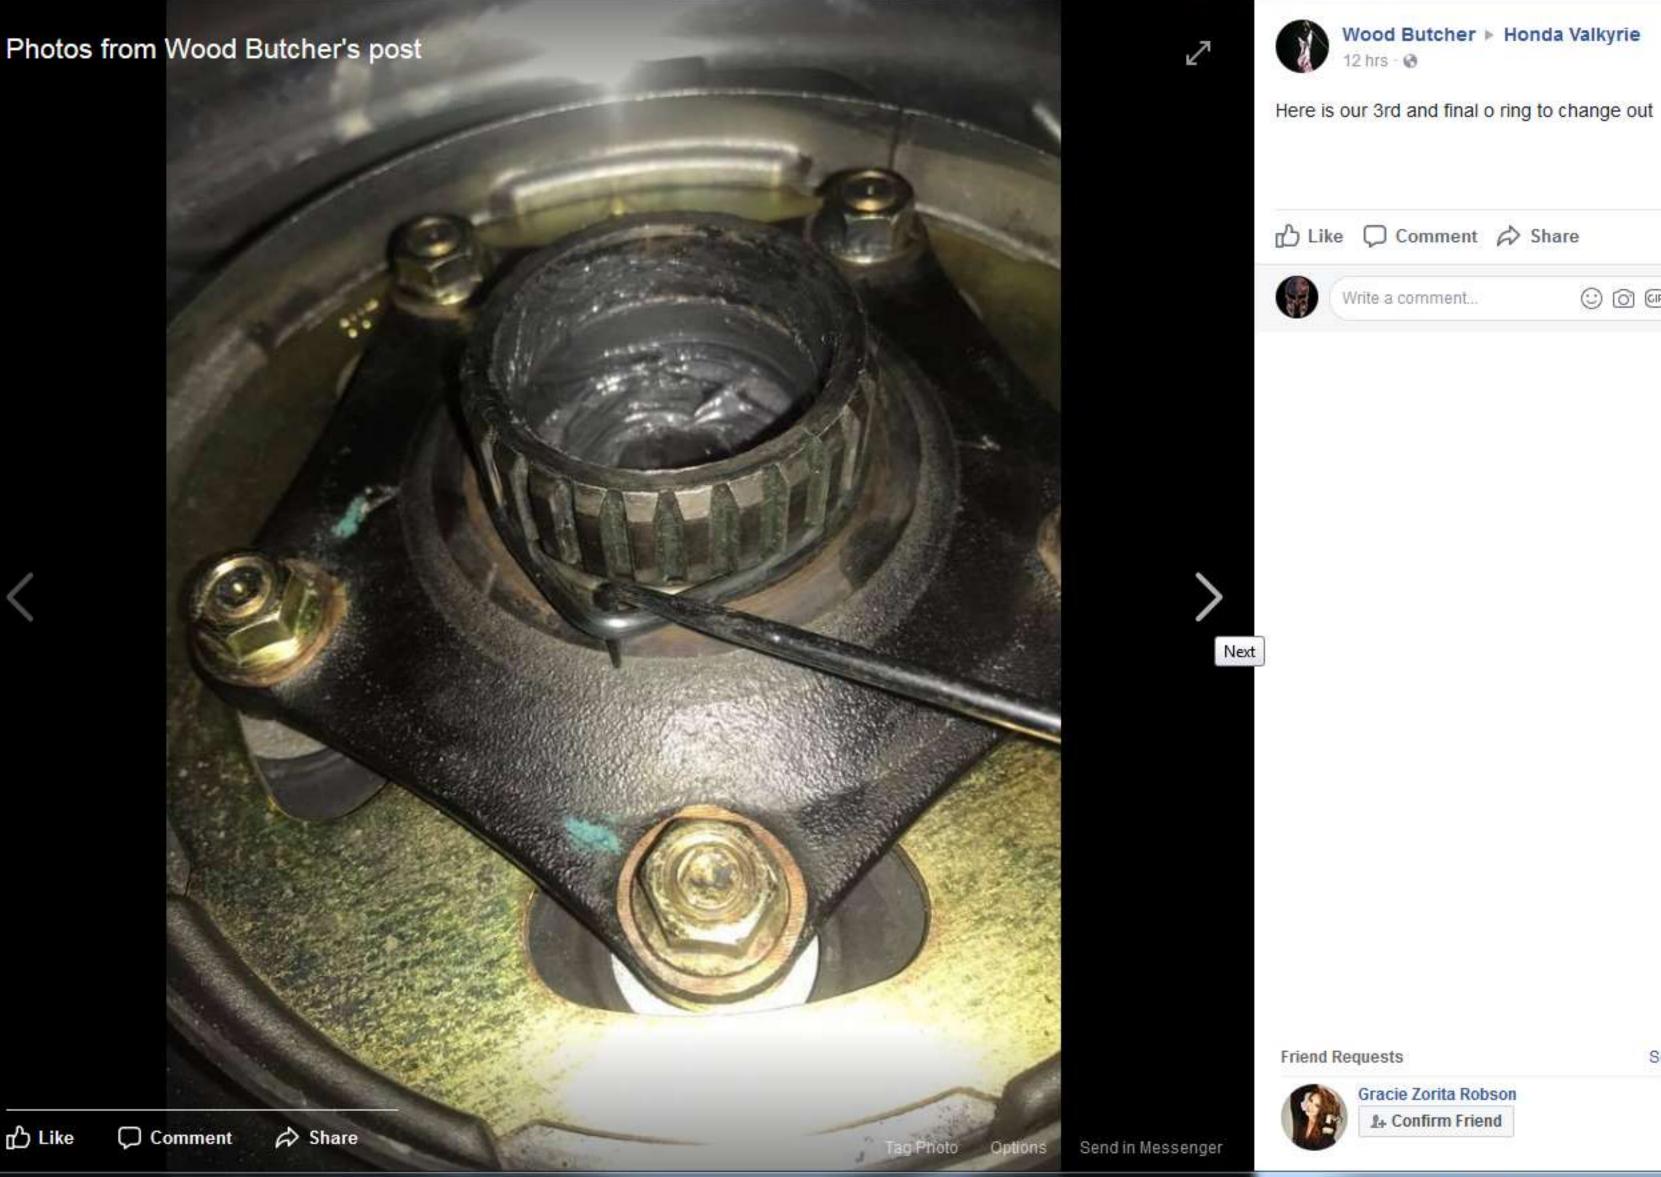

Desktop ** 🔺 🥻 🔐 (*) 8:06 AM

© @ @ Ø

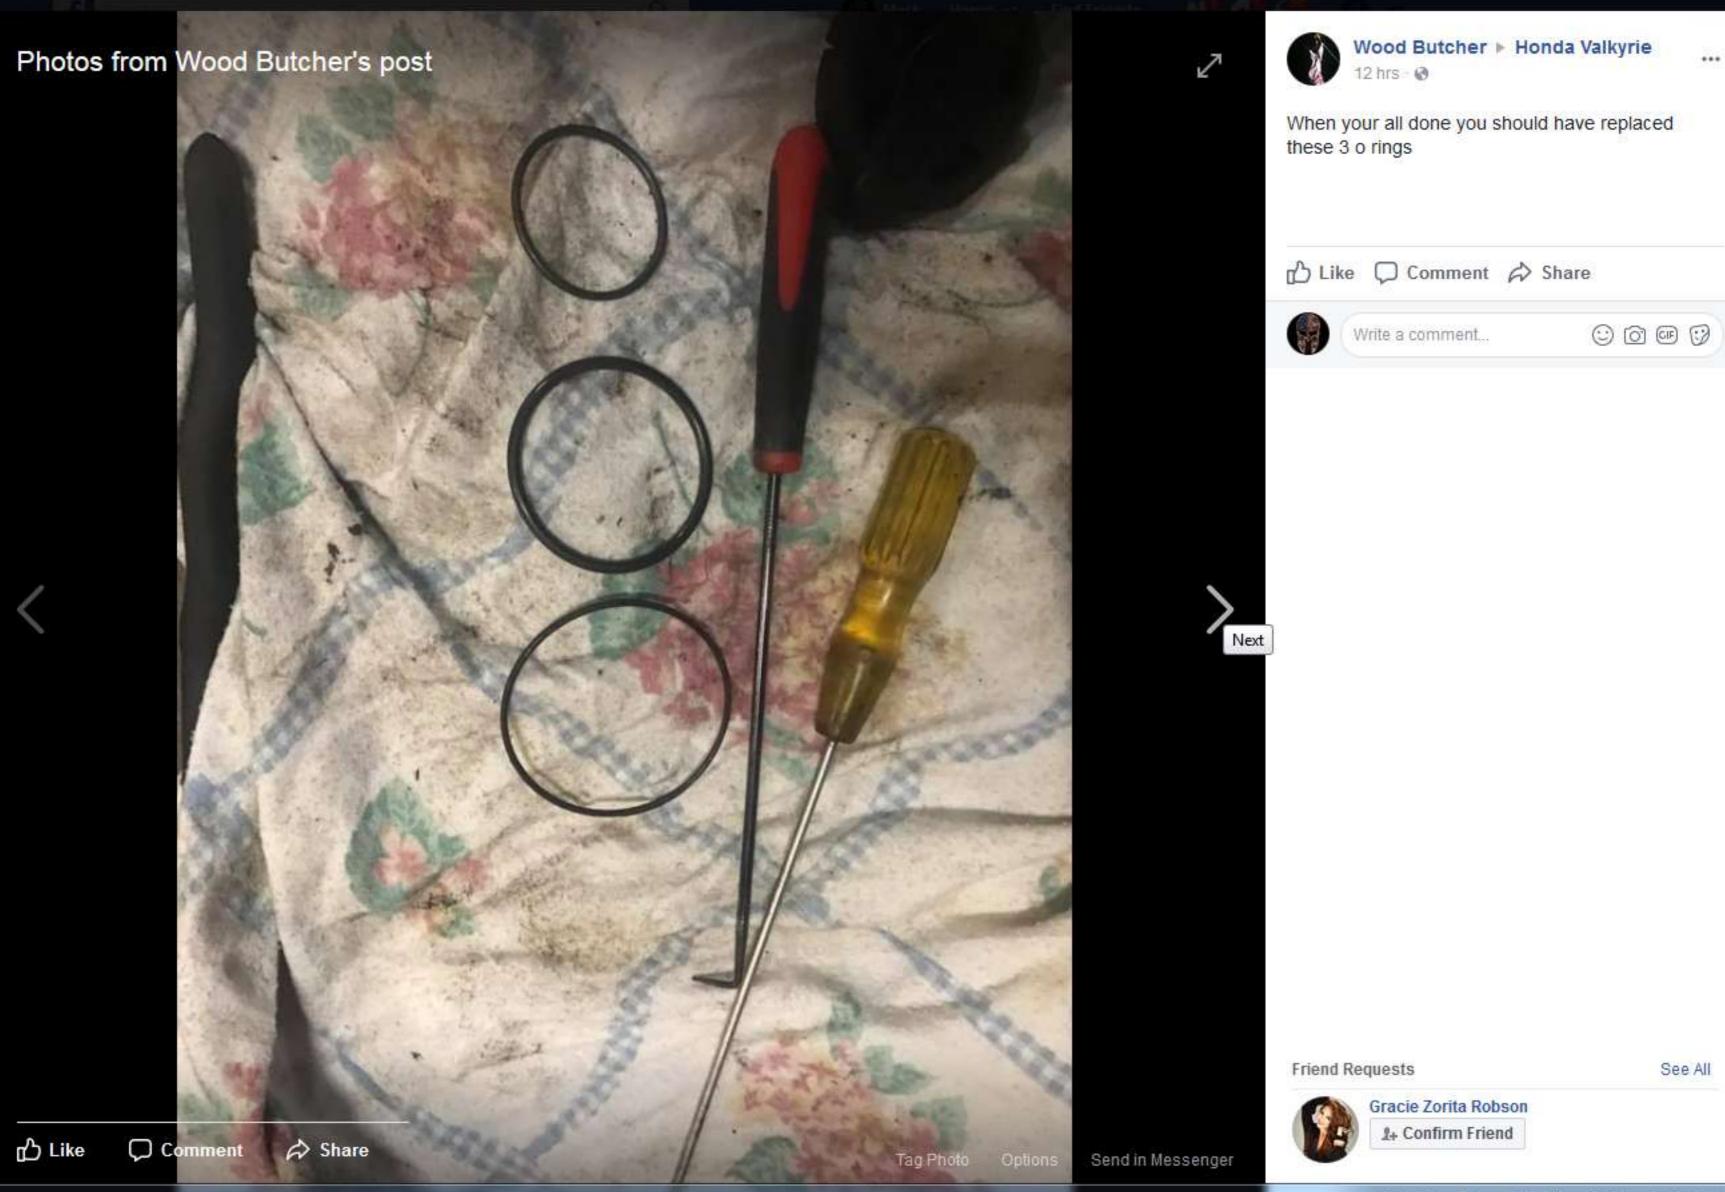



Wood Butcher ► Honda Valkyrie

After pulling the driveshaft out of the final drive I inspect the shaft and pinion cup splines.

Like
 □ Comment
 ⇔ Share



Write a comment...





© @ @ @

See All



Gracie Zorita Robson 1+ Confirm Friend



Friend Requests



Wood Butcher ► Honda Valkyrie 12 hrs - 🔞

I remove the pinion cup to clean it

Like
 □ Comment
 ⇔ Share



Write a comment...





Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend



Like

Comment Comment

⇔ Share

Tag Photo

Options



Wood Butcher ► Honda Valkyrie

I use a 7/8" socket

Like
 □ Comment
 ⇔ Share

Write a comment...

© @ @ @



Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend











And an impact wrench. Hold the cup and let er rip

Like
 □ Comment
 ⇔ Share

Write a comment...



© @ @ @

Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend

_____Like

Comment Comment

Options





Once the nut is removed you can pull the pinion cup



© @ @ 0

Friend Requests

See All



Like

Comment Comment

⇔ Share



Wood Butcher ► Honda Valkyrie

This had quite a bit of grease in it but one of the holes was still open

Like Comment A Share



Write a comment...





© @ @ 0



Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend

Tag Photo

Like

Comment Comment

⇔ Share



Wood Butcher ▶ Honda Valkyrie

Clean the cup up real good and be sure the holes are open and clean

Like
 □ Comment
 ⇔ Share

Write a comment...

© @ @ 0



Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend

Tag Photo





All 3 holes, there is one on the side of the cup you can't access unless you remove the cup

Like
 □ Comment
 ⇔ Share



Write a comment...









Friend Requests

See All







Remove the fill plug with a 17mm socket

🖒 Like 🔘 Comment 🖨 Share

Write a comment...





© @ @ Ø


Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend



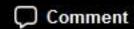

Like

Comment 💭

⇔ Share





Remove the drain plug with the same 17mm socket

Write a comment...






© @ @ Ø

Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend

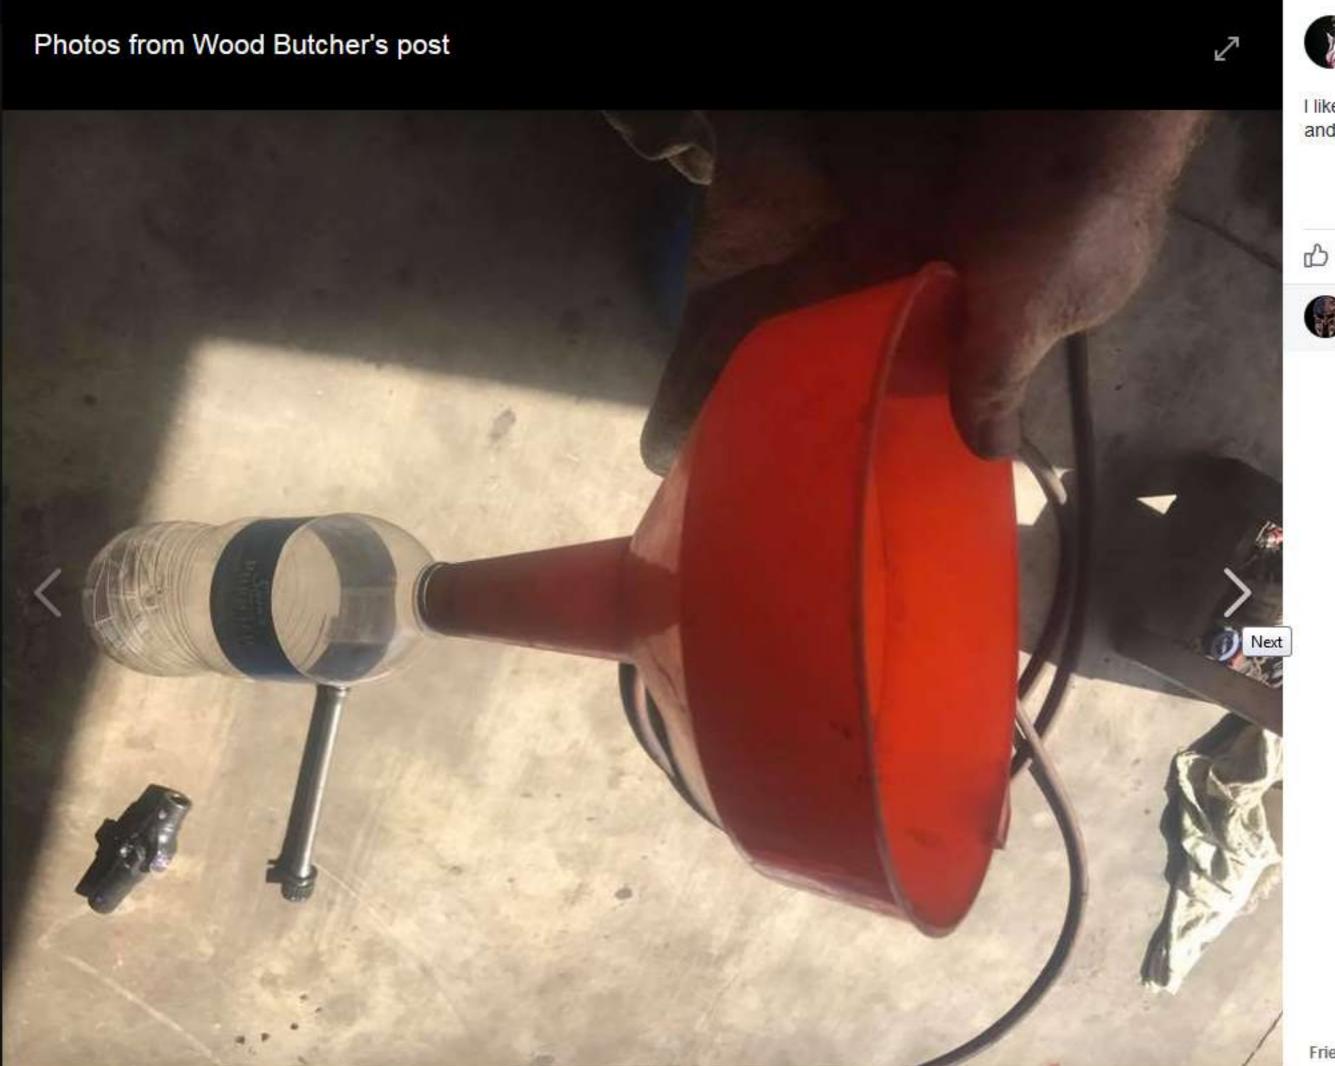



I like to look at what comes out for metal particles and use a funnel into a water bottle

Like
 □ Comment
 ⇔ Share

Write a comment...

© @ @ @

Friend Requests

See All



Gracie Zorita Robson 1+ Confirm Friend

Like

Comment Comment

r Like

Comment Comment

⇔ Share





I pour the gear oil out of the final drive into the funnel to completely drain it.

Like
 □ Comment
 ⇔ Share

Write a comment...

Friend Requests

See All


© @ @ Ø



Send in Messenger

Tag Photo

Options

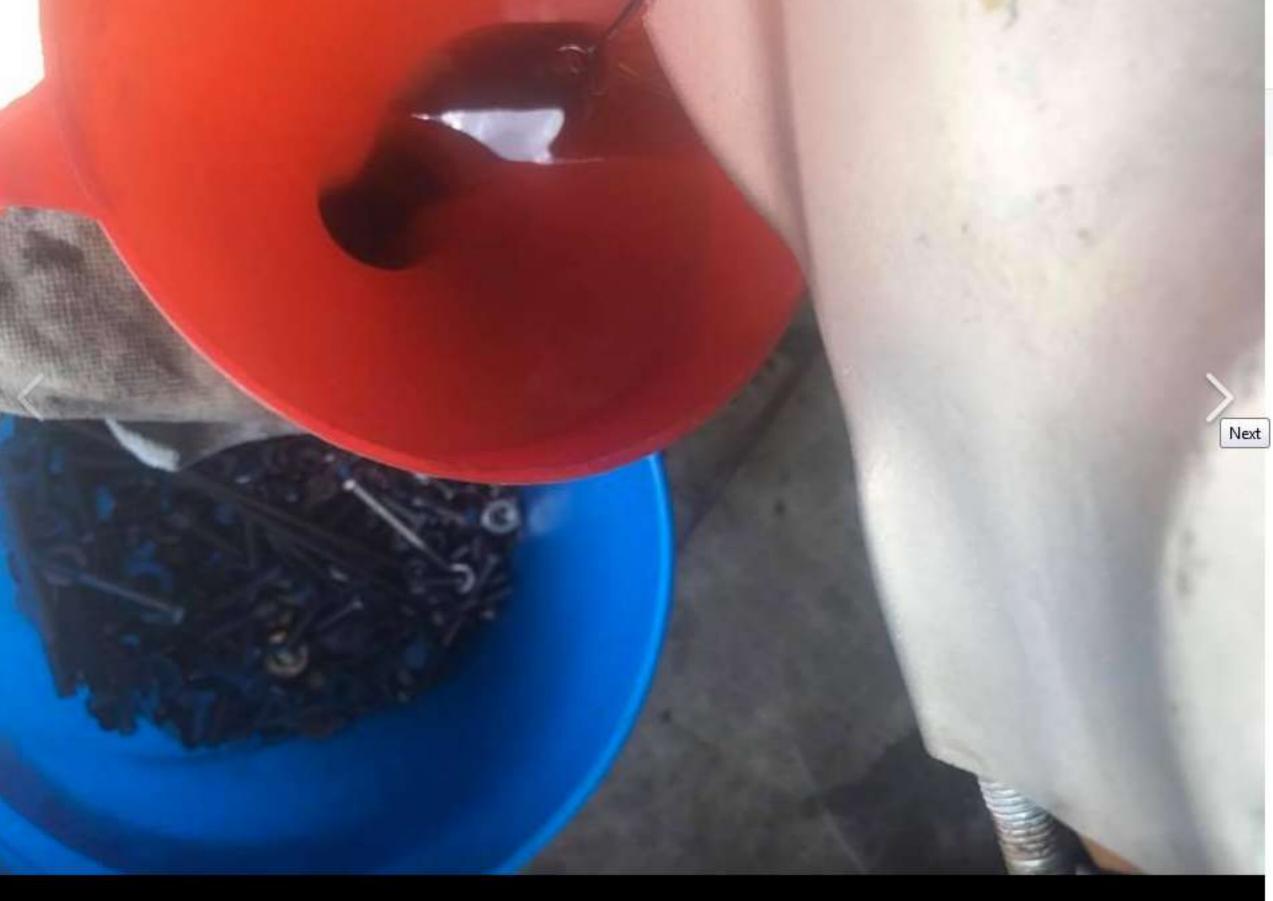







Pretty dirty just a few little metal particals, the last guy definitely didn't change this when he just serviced it. I'd bet this is the original factory oil

Like
 □ Comment
 ⇔ Share











Friend Requests

See All

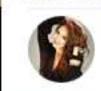

Gracie Zorita Robson 1+ Confirm Friend



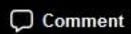





Tag Photo

Send in Messenger

Options



Wood Butcher ► Honda Valkyrie

Clean the driveshaft splines on both ends real good and check for wear. These still look new.

Like
 □ Comment
 ⇔ Share



Friend Requests


See All

© @ @ 9








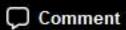



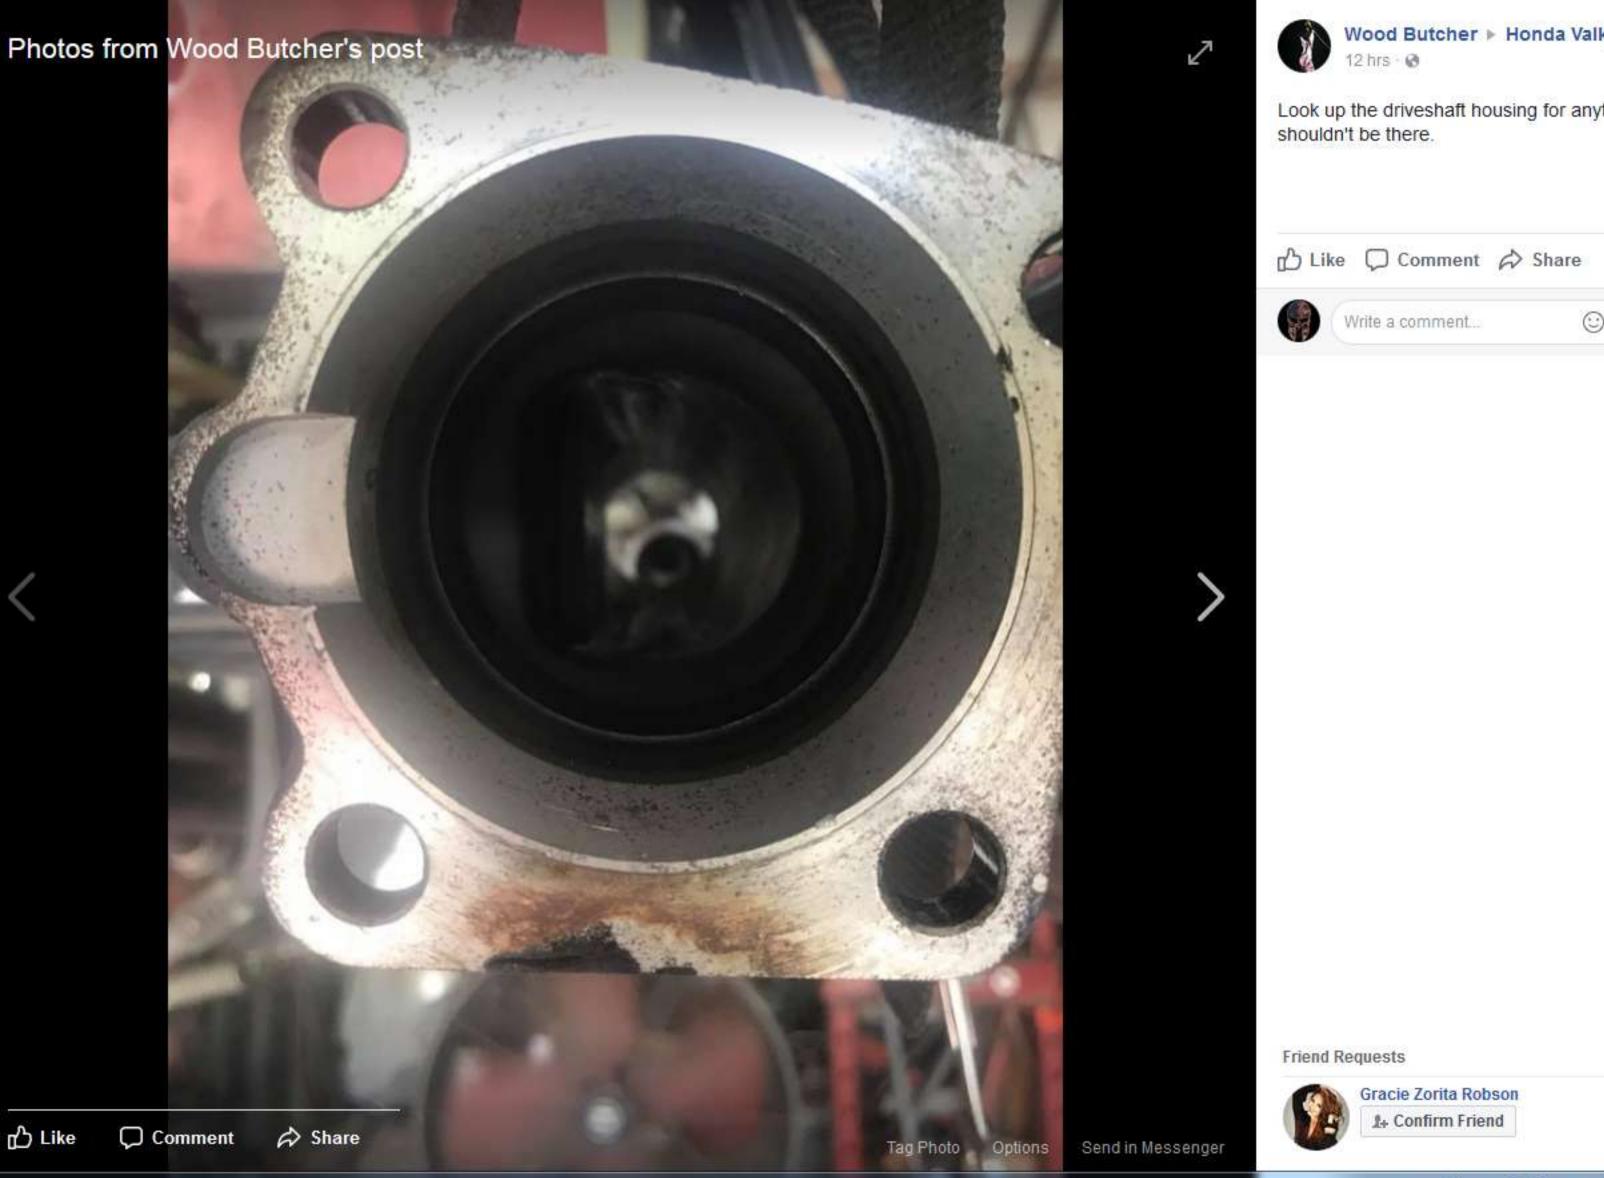



Look up the driveshaft housing for anything that





© @ @ 9

See All





Can't let these stay on there. Friends don't let friends ride on OEM stems.

Like
 □ Comment
 ⇔ Share

OO 4

Write a comment...

© @ @ @



Friend Requests


See All




Gracie Zorita Robson 1+ Confirm Friend





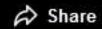

Options

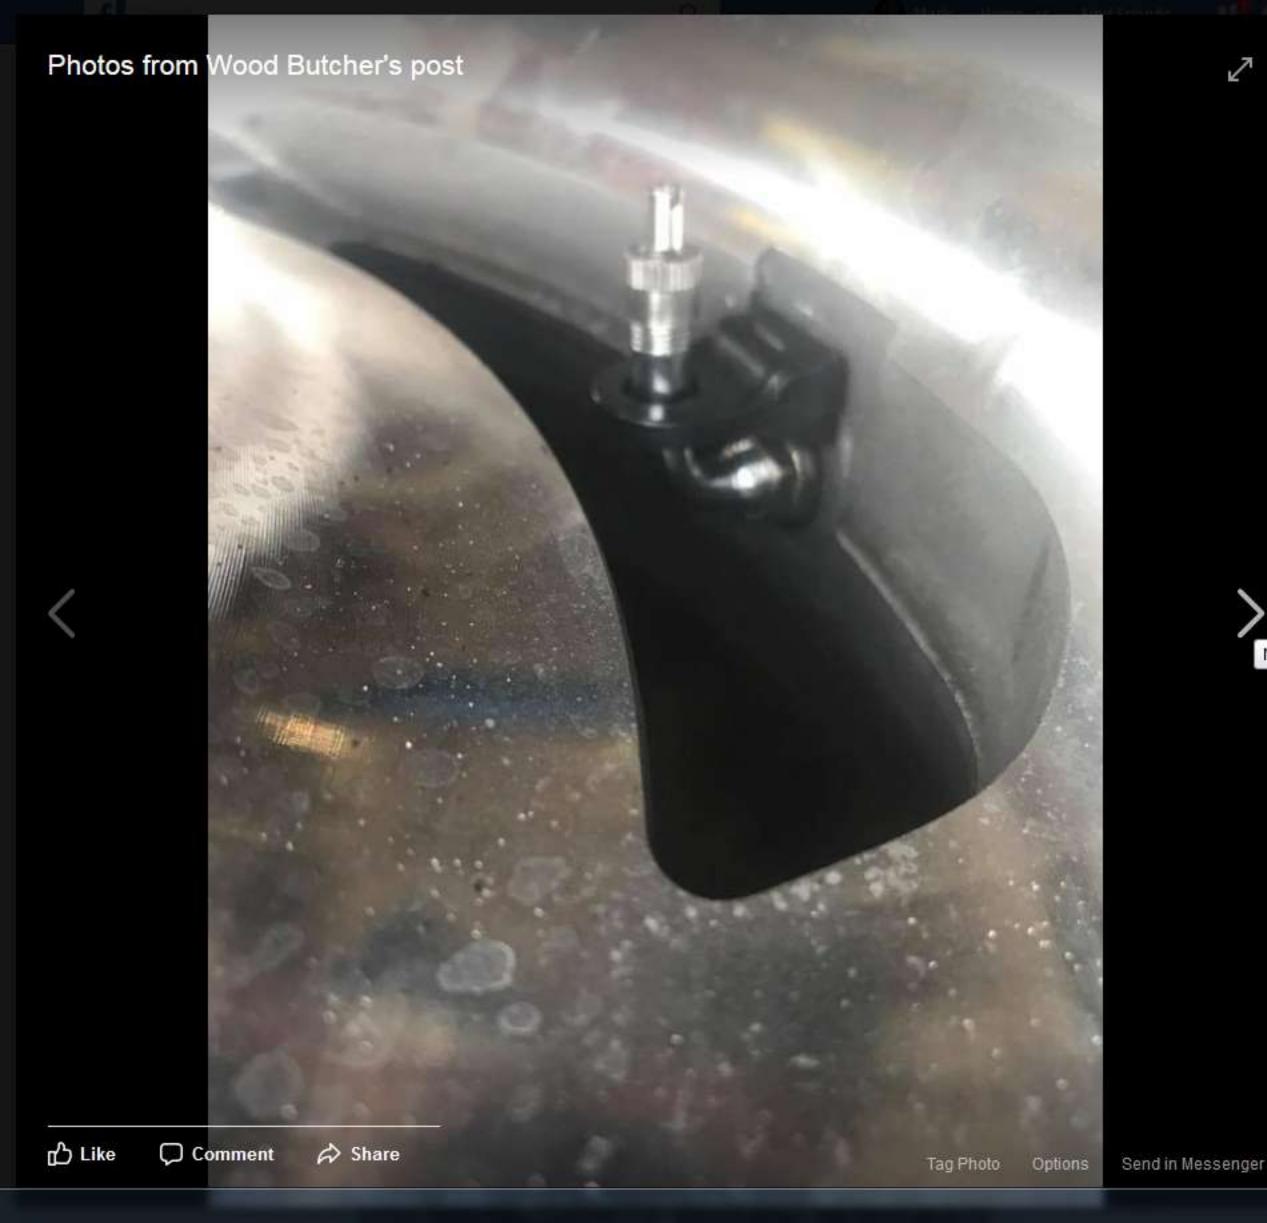



I change it out for an all metal stem from Jakewilson.com



Write a comment...





© @ @ Ø

Friend Requests

See All

